Asbestos in Billiard table Irons and Stands

Purpose

This safety alert provides information about the potential presence of asbestos in the insulation layer of hand-held billiard table irons and associated iron stands, from the People's Republic of China (China). Online sellers of these items exist in China, India and Taiwan. The item identified in Australia was imported from a supplier in China. A similar but not identical item, with no asbestos, is marketed from the United Kingdom.



Figure 1: Billiard table iron with (white coloured) asbestos insulating layer, visible between the green housing and lower steel plate.

Background

In December 2020, the WA Department for Mining, Industry Regulation and Safety (DMIRS) were alerted to the presence of chrysotile asbestos in irons imported to Australia. The iron stand on which the iron rests, also contains an insulating layer with asbestos.

Product description

Just over 24cm in length, the hand-held iron is designed to flatten the cloth on billiard tables. A range of types and sizes are commercially available. Those manufactured in countries where asbestos is not banned are likely to contain chrysotile asbestos. Irons imported with asbestos are prohibited imports. The irons maybe lawfully imported without the asbestos layer.



Figure 2: Image shows use. The model shown is not the affected iron.



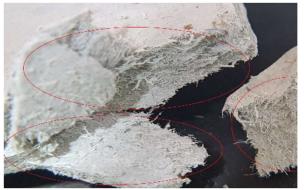


Figure 3: Insulating layer in situ.

Figure 4: Close up of insulating layer material.

Asbestos in imported products

While asbestos has been prohibited in Australia since December 2003, in some countries it is still used in manufactured products. Certification of asbestos-free goods from some overseas manufacturers have been found not to meet Australian requirements. The importation, manufacture, supply, sale and use or reuse of asbestos and asbestos-containing products is not permitted, except under very limited circumstances. Some supplier countries may classify goods with low levels of asbestos as 'asbestos-free'. In Australia, any level of asbestos is prohibited for import or use.

Risk control

The design of the irons typically negates the need for maintenance during the life of the equipment. During normal use there should be little risk of asbestos fibre release. If the iron wears over time, however, there may be a risk of exposure. Owners or users of the identified billiard table irons are advised not to undertake any maintenance, repairs or modifications. They should contact the Australian supplier for clarification and/or seek the guidance of an asbestos professional.

Action Required

- Importers must ensure they do not import asbestos into Australia. They need to be aware of the
 varying definitions and standards applied in the country of origin and/or supply and ensure they
 receive adequate evidence of non-asbestos materials used by the manufacturer. A declaration of
 no asbestos from the overseas supplier, on its own, is not acceptable evidence.
- When a risk is identified at the border, the ABF will require assurance from the importer, in the form of documentary evidence, that the goods do not contain asbestos. A test report from a NATA accredited laboratory (or equivalent international laboratory) showing no detectable asbestos is the best form of assurance. If adequate assurance is not provided, importers will face delays and be responsible for costs incurred when the goods are held at the border for the purposes of sampling and testing. See the ABF website for further information.
- Retailers that might be in possession of the affected irons or might have sold the irons on to consumers, should contact their local Work Health Safety (WHS) regulator for advice. Contact details are provided in the table below.
- If you are concerned you have purchased an affected billiard table iron, you should first check the recalls information from the Australian Competition and Consumer Commission via:

https://www.productsafety.gov.au/recalls. Your supplier could be contacted for further information and assurances if they are not part of the current recall.

- If a consumer wish to dispose of equipment they believe may contain asbestos, they should take it to a licensed facility that handles hazardous waste. Further information on the disposal of asbestos waste may be obtained from local government authorities, the relevant environmental protection authority or waste disposal authority in your state or territory.
- Further information about the recall

Where do I get advice?

If unsure what to do, contact your State/Territory/Commonwealth WHS regulator:

	•	• • • • • • • • • • • • • • • • • • • •	
Jurisdiction	Regulator	Contact Details	Website
Cwealth	Comcare	1300 366 979	www.comcare.gov.au/
QLD	Workplace Health and	1300 362 128	www.worksafe.qld.gov.au/
	Safety Qld		
QLD	QLD Gov Asbestos page	13 74 68	www.asbestos.qld.gov.au/
ACT	WorkSafe ACT	02 6207 3000	www.worksafe.act.gov.au/
ACT	ACT Gov Asbestos page	13 22 81	www.asbestos.act.gov.au/
NSW	Safework NSW	13 10 50	www.safework.nsw.gov.au/
NSW	NSW Gov Asbestos	13 10 50	www.asbestos.nsw.gov.au/
	page		
NT	Worksafe NT	1800 019 115	www.worksafe.nt.gov.au/
NT	NT Gov Asbestos page	1800 019 115	www.asbestos.nt.gov.au/
SA	SafeWork SA	1300 365 255	www.safework.sa.gov.au/
SA	SA Gov Asbestos page	1300 365 255	www.asbestos.sa.gov.au/
TAS	Worksafe TAS	1300 366 322	www.worksafe.tas.gov.au/
VIC	Worksafe VIC	1800 136 089	www.worksafe.vic.gov.au/
VIC	Vic Gov Asbestos page	1800 136 089	www.asbestos.vic.gov.au/
WA	WorkSafe WA	1300 307 877	www.commerce.wa.gov.au/WorkSafe
NZ	WorkSafe NZ	+64 0800 030 040	www.worksafe.govt.nz

This Alert has been developed by the Heads of Workplace Safety Authorities (HWSA) Imported Materials with Asbestos Working Group, whose membership comprises representatives from: Australian Border Force, Asbestos Safety and Eradication Agency, Attorney General's Department, Australian Competition & Consumer Commission, New Zealand Customs Service, Comcare, Safe Work Australia, SafeWork NSW, SafeWork SA, NT WorkSafe, Workplace Health and Safety Queensland, WorkSafe ACT, WorkSafe Tasmania, WorkSafe Victoria and WorkSafe WA, WorkSafe NZ.